

Subject JVM Software Update Procedure

Class: INFO

Series V-Range (501,651,801)

Revision: D Sheet 1 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

With the introduction of CAN communication and control on the truck mounted range of Johnston Sweepers, there is now the added functionality to update the software of the JVM adding additional features and upgrades to the sweeper.


Step One: Prepare USB Flash Drive

- 1.1 Obtain the latest version of the V-Range "TMS_SoftwareServicePackage_x.zip" from Johnston Customer Service. The last digit of the file name will indicate the revision level. For example "TMS_SoftwareServicePackage_C" = Revision level C.
- 1.2 Unzip the file "TMS_SoftwareServicePackage_x.zip"
- 1.3 Erase ALL data contained on the USB flash drive (Part No: 7022225)



Figure One: JSL USB Flash Drive

- 1.4 Add the **contents** of the folder "TMS_SoftwareServicePackage" to the USB flash drive.
- 1.5 Check to ensure that the USB flash drive file structure is identical to the image shown in figure Two

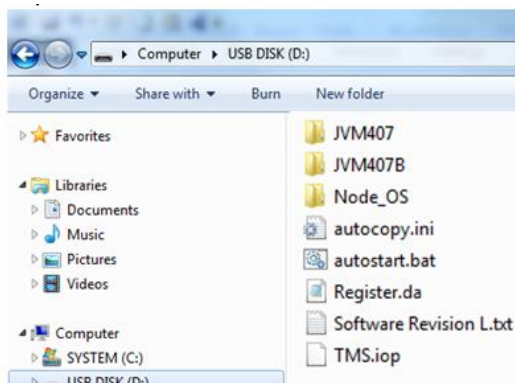

Control Software, now within two folders, the USB will automatically detect which one to load
Node OS Files
Files for download, USB will automatically detect which one to use
Register to Preset Bytes in JVM
Revision Note text
Graphical File

Figure Two: File listing on USB flash drive (New look structure shown from revision L)

Johnston Sweepers Limited, Curtis Road, Dorking, Surrey RH4 1XF
Tel: +44 (0)1306 884722 Fax: +44 (0)1306 884151
www.johnstonsweepers.com E-mail: enquiries@johnstonsweepers.com



Class 1 = Immediate, **Class 2** = At next service point, **Class Info** = For parts and service information.

The Information in this bulletin should not be interpreted as the basis for any claims unless so designated by Johnston Sweepers Limited.
[Changes on this document from the previous issue are shown in Blue Font.](#)

Form No.031 Issue 016 – Jan 2009

Subject JVM Software Update Procedure

Series V-Range (501,651,801)

Class: INFO

Revision: D Sheet 2 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

Step Two: Determine the Controller type

2.1 Switch on the ignition and take note of any text that appears in the bottom right hand corner of the display during the time taken for the progress bar to fill.



Figure Three: Controller Type

2.2 The same information is available in menu 4.2.1.1. If you saw text stating “JVM407-B” then proceed to step four. Otherwise if you saw “JVM407” or there was no text continue to step three

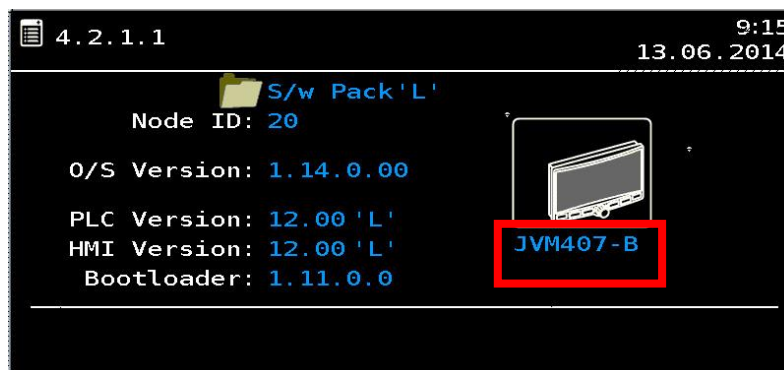


Figure Four: Controller Type

Step Three: Software Download – JVM-407

3.1 Ensure the ignition is off.

3.2 Carefully open the rubber cover on the front of the JVM to expose the USB port.

3.3 Insert the USB flash drive into USB port.

Johnston Sweepers Limited, Curtis Road, Dorking, Surrey RH4 1XF
Tel: +44 (0)1306 884722 Fax: +44 (0)1306 884151
www.johnstonsweepers.com E-mail: enquiries@johnstonsweepers.com

Class 1 = Immediate, **Class 2** = At next service point, **Class Info** = For parts and service information.
The Information in this bulletin should not be interpreted as the basis for any claims unless so designated by Johnston Sweepers Limited.
[Changes on this document from the previous issue are shown in Blue Font.](#)

 **Johnston**

Form No.031 Issue 016 – Jan 2009

Subject JVM Software Update Procedure

Series V-Range (501,651,801)

Class: INFO

Revision: D Sheet 3 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

3.4 Press and hold buttons F1 & F3 on the display.



3.5 Switch on the ignition.

3.6 Release buttons F1 & F3 when the following text appears;

“start operating system in STOP mode”

3.7 Software will now download from the USB flash drive automatically.

Note: Software download can take 5-10 minutes depending on the size of the update.

******Never switch off the ignition, isolate the vehicle or disconnect the harness during the download process******

3.8 Once the software download is complete the following message will appear;

“Press any key or touch screen to continue”

Press any of the JVM buttons to continue.

3.9 The JVM will now reboot. Once rebooted, turn off ignition of machine.

******First shutdown of machine after software update may take 4-5 min. Never isolate the vehicle or disconnect the harness while this takes place******

3.10 Remove the USB flash drive and continue to step five.

Subject JVM Software Update Procedure

Series V-Range (501,651,801)

Class: INFO

Revision: D Sheet 4 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

Step Four: Software Download – JVM-407B

*****Software Packs predating 'L' will not function on the JVM-407B unit*****

4.1 Ensure the ignition is off.

4.2 Carefully open the rubber cover on the front of the JVM to expose the USB port.

4.3 Insert the USB flash drive into USB port.

4.4 Switch the ignition on. The update process will begin automatically

Note: Software download can take 5-10 minutes depending on the size of the update.

******Never switch off the ignition, isolate the vehicle or disconnect the harness during the download process******

4.5 The display can reboot twice during the update download procedure. This step of the update procedure is complete when the display performs a normal boot sequence and reloads the standby screen (Clock page).

4.6 Remove the USB drive from the JVM-407B and continue with step five

Subject JVM Software Update Procedure

Class: INFO

Series V-Range (501,651,801)

Revision: D Sheet 5 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

Step Five: Passcode Entry

5.1 Start JVM, press the ignition and then press button F3 to access the Main Menu 4.0.



Figure Five: Menu 4.0, Main Menu

5.2 Select Menu 4.14 – System Security.

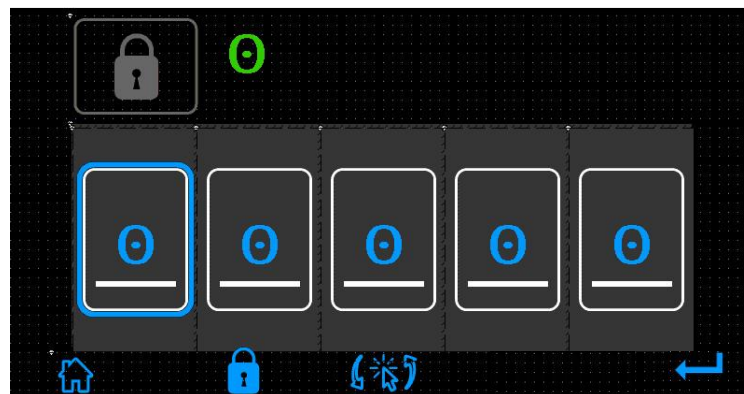


Figure Six: Menu 4.14, System Security

5.3 Enter the “Service” passcode 88335.

5.4 Press the “Enter” key F4.

5.5 Exit the menu by pressing F1.

Subject JVM Software Update Procedure

Class: INFO

Series V-Range (501,651,801)

Revision: D Sheet 6 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

Step Six: Operating System (OS) Update

6.1 Go to Menu 4.11 – Service, and **select option 3, OS Downloads.**

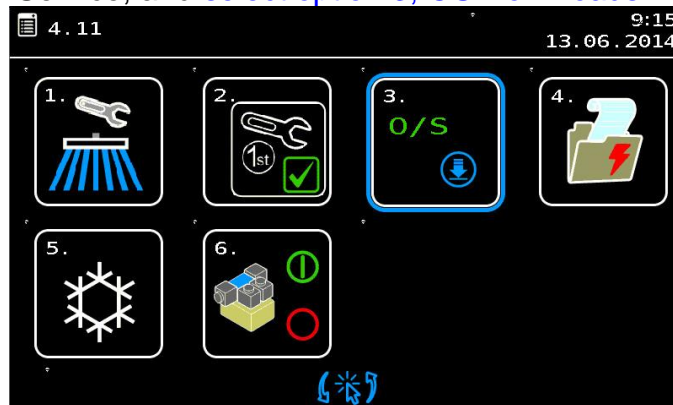


Figure Seven: Menu 4.11, Service Menu

6.2 Select the area of the sweeper which a node operates (E.g Hopper)

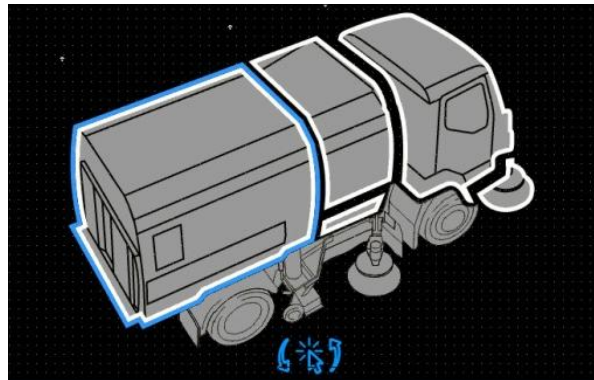


Figure Eight: Menu 4.11.2 , Sweeper Area Select

6.3 Select a specific node (E.g Hopper IO Node) **(Mark 1 Electrical only)**



Figure Nine: Menu 4.11.2 , Subframe Nodes

Johnston Sweepers Limited, Curtis Road, Dorking, Surrey RH4 1XF
Tel: +44 (0)1306 884722 Fax: +44 (0)1306 884151
www.johnstonsweepers.com E-mail: enquiries@johnstonsweepers.com



Class 1 = Immediate, **Class 2** = At next service point, **Class Info** = For parts and service information.
The Information in this bulletin should not be interpreted as the basis for any claims unless so designated by Johnston Sweepers Limited.
[Changes on this document from the previous issue are shown in Blue Font.](#)

Form No.031 Issue 016 – Jan 2009

Subject JVM Software Update Procedure

Series V-Range (501,651,801)

Class: INFO

Revision: D Sheet 7 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

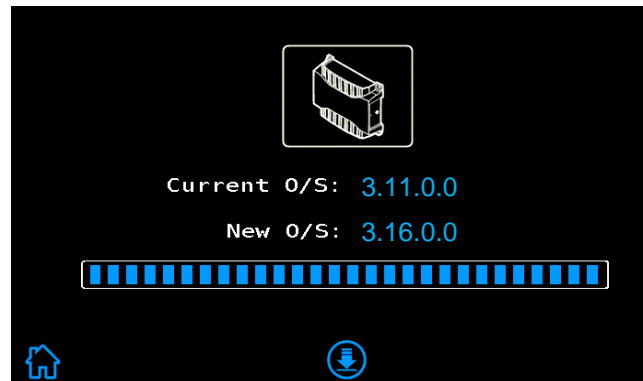


Figure Ten: Menu 4.11.2.4.1 Subframe IO Node

6.4 Compare the Current O/S number with the New O/S number and if different, the Node O/S must be updated

6.5 To download the "New OS", press the centre button on the JVM to start the OS update. The blue bar will indicate the progress of the download.

*****Never switch off the ignition, isolate the vehicle or disconnect the harness during the download process*****

6.6 Once the green tick appears and the text updates, the OS download is complete.

6.7 Repeat the process for the Centre console, Palm Controller, System Locker IO Node, Powapak IO Node and the High Current Nodes

6.8 Once all OS Updates are complete, exit from the Menus and switch off the ignition.

6.9 Wait one minute and then switch on the ignition.

Technical Bulletin

TB1570

Subject JVM Software Update Procedure

Class: INFO

Series V-Range (501,651,801)

Revision: D Sheet 8 of 8

Release Date: 06.10.2014

ECM: 712616

Product Code: A + B

Step Seven: Clear Emergency Codes

7.1 Go to Menu 4.2 – CANbus Information.

7.2 Select the Sub Menu for the Powapak IO Node


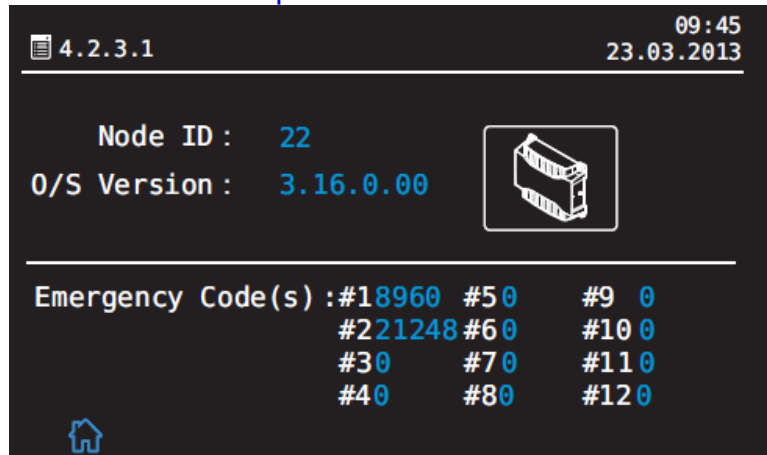


Figure Eleven: Menu 4.2.3.1 Powapak IO Node

7.3 Press together the following buttons to clear the codes

Rotary Encoder + F4

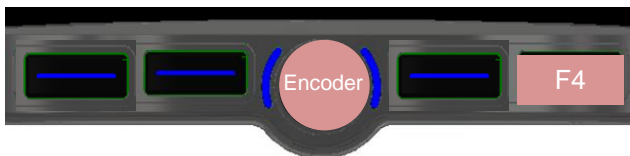

7.4 Repeat the process for the System Locker IO Node, Hopper IO Node (and the High Current Nodes (Mark 1 Electrical only))

7.5 Switch off the ignition, the JVM software update is now complete

Parts Required

Item	Part No.	Description	Quantity
1	7022225	USB Stick	1
2	7029152	TMS Software Service Package Files	1

Standard repair time = 20 minutes

Johnston Sweepers Limited, Curtis Road, Dorking, Surrey RH4 1XF
Tel: +44 (0)1306 884722 Fax: +44 (0)1306 884151
www.johnstonsweepers.com E-mail: enquiries@johnstonsweepers.com



Class 1 = Immediate, **Class 2** = At next service point, **Class Info** = For parts and service information.
The Information in this bulletin should not be interpreted as the basis for any claims unless so designated by Johnston Sweepers Limited.
[Changes on this document from the previous issue are shown in Blue Font.](#)

Form No.031 Issue 016 – Jan 2009

User: COBBOLD Abt.: // 06.10.2014 14:47:33

TB1570 JSB 000 03 Rev:D